




**TRADEMARK
HARDWARE**
WORLD OF QUALITY HARDWARE
WWW.TMHARDWARE.COM


IN ORDER TO MEET UNDERWRITERS LABORATORIES REQUIREMENTS, THE FOLLOWING CONDITIONS MUST BE MET:

- 1). USE A UL LISTED CLASS 2 ENERGY LIMITING TRANSFORMER WITH A MINIMUM POWER OUTPUT OF 12 VA, SUCH AS ADAMS RITE 4605.
- 2). THE TRANSFORMER MUST BE MOUNTED EXTERNAL TO THE DOOR ON A NEARBY JUNCTION BOX IN ACCORDANCE WITH NATIONAL ELECTRICAL CODE.
- 3). THE WIRES MUST BE PROTECTED FROM ABRASION WHERE THEY PASS THROUGH THE HOLE IN THE HINGE RAIL. A RUBBER GROMMET IS SUFFICIENT. SEE ILLUSTRATION 1.

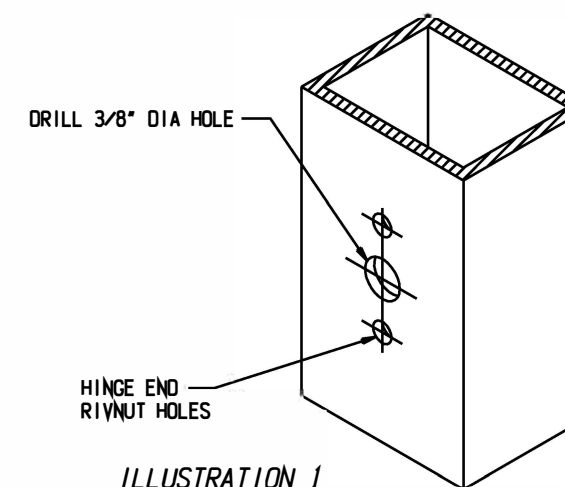


THREE SIMPLE ALTERNATIVES FOR HOOKING UP SWITCH IN MONITORING EXIT BAR

ALTERNATIVE 1

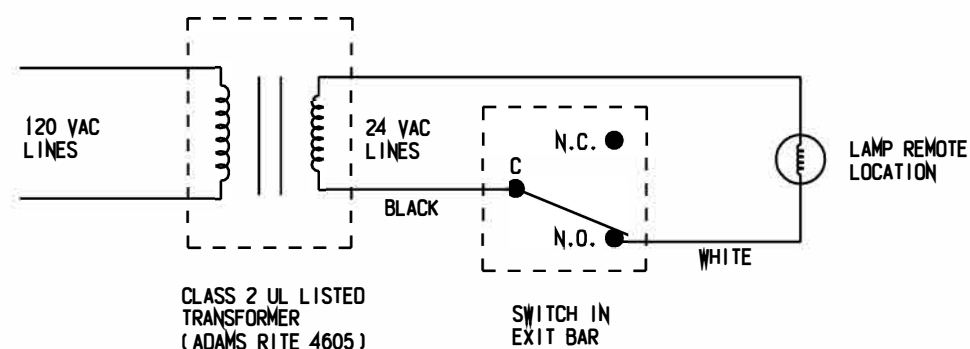


LAMP GOES ON WHEN BAR IS PUSHED DOWN.

ALTERNATIVE 2

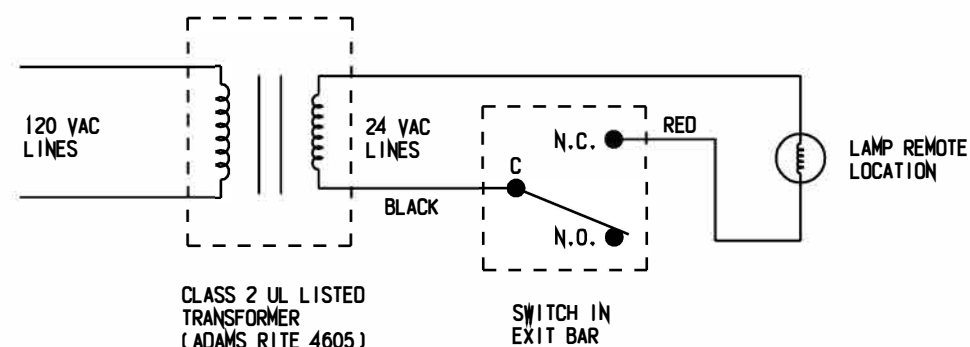


LAMP GOES OUT WHEN BAR IS PUSHED DOWN.

ALTERNATIVE 3

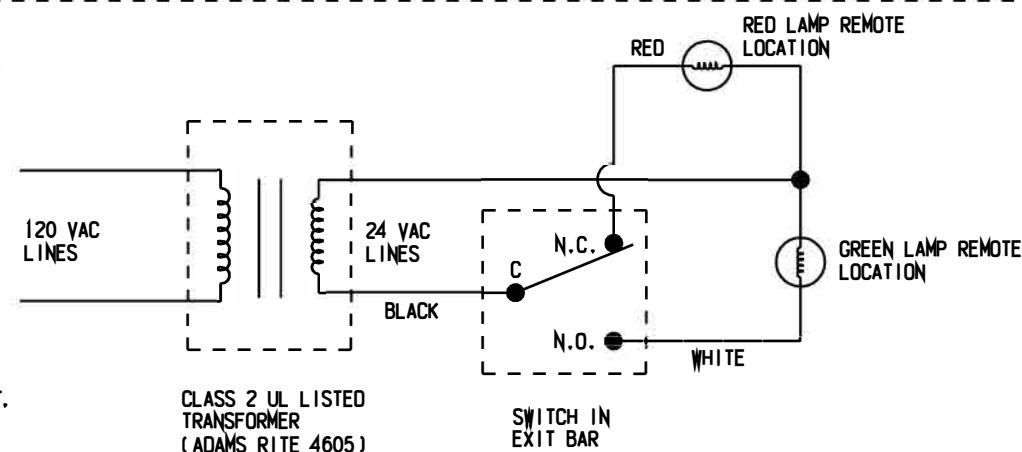

RED LAMP IS ON WHEN EXIT BAR IS IN STANDBY (NOT DOGGED DOWN), EXTENDED POSITION, GREEN LAMP OUT.
GREEN LAMP IS ON WHEN EXIT BAR IS PUSHED DOWN, RED LAMP OUT.

MONITOR SWITCH ASS'Y INSTALLATION

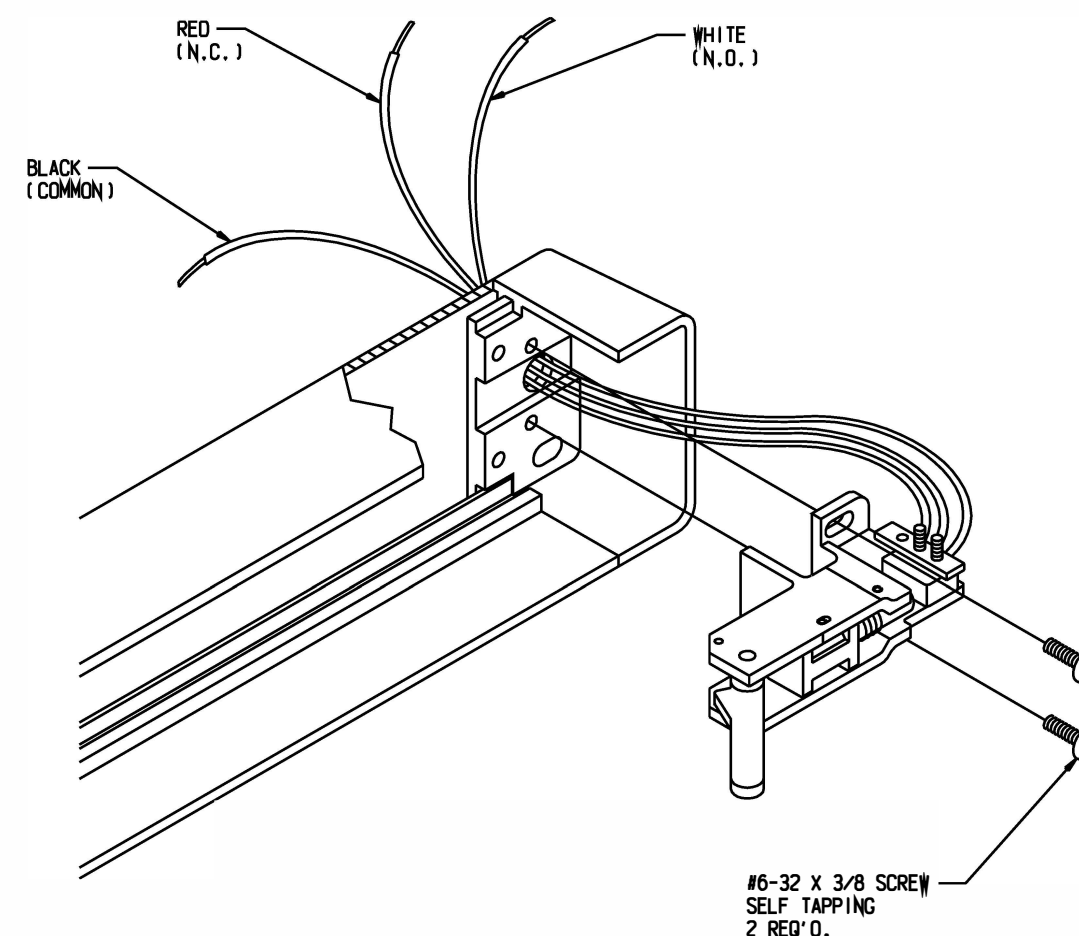

PRODUCT MUST BE INSTALLED
ACCORDING TO ALL APPLICABLE
BUILDING AND LIFE SAFETY CODES



www.adamsrite.com
Phone: 800-626-7590
800-872-3267
Fax: 866-582-4641
800-232-7329

80-0180-178

Rev. B

MONITORING SWITCH INSTALLATION & WIRING INSTRUCTION

Ecn 11955A

Date: 06-28-12

Page 1 of 1

Appvd:

Date: